



- Real Estate Inspections
- Infrared Thermography
- Stucco Inspections
- Diagnostic Inspections
- and more

*Providing Peace of Mind  
One home at a time  
Since 1989*

## **INSPECTION GROUP**

FIG Services LLC d/b/a FOX INSPECTION GROUP  
Property Inspection Report # 090313jh  
11227 Endicott Lane Houston, TX 77035  
(Office) 713.723-3330 (Email) [office@foxinspectiongroup.com](mailto:office@foxinspectiongroup.com)

---

TREC Professional Inspectors # 1718, 3648, 5570, 6000, 6389, 7158, 7244, 7248, 7406, 7415, 7466, 7657, 7932, 9355, 9378, 9459

NAWT – Septic Inspector # 111984 IC

SBCCI Registered Building Inspector #5939

SBCCI Registered Mechanical Inspector # 1739

Exterior Design Institute (EDI) # TX-116, TX-119

ICC Building Inspectors # 1052678-B5, #5294898-B5

State of Texas Registered Code Enforcement Officer # CE1858

ICC Residential Combination Inspectors # 1052678-R5, #5294898-R5

ICC Residential Building Inspectors # 5167093-B1, #5294898-B1

ICC Mechanical Inspectors # 1052678-M5, #5294898-M5, 5230842-M1

Texas Department of Insurance VIP Certificates #20110061045, # 33901081163

SBCCI Registered One & Two Family Dwelling Code Certified Inspector #1863 & #2185

ITC Certified Level 1 Infrared Thermographers #8661, #8662, #8663, #8692, #8693, #8694, #26034, #26504, #26505

### **2004 Heritage Creek Area Home Inspection Report**

# ***PROPERTY INSPECTION REPORT***

---

**Prepared For:** client  
(Name of Client)

**Concerning:** 2004 Heritage Creek area, Houston, Texas 77008  
(Address or Other Identification of Inspected Property)

**By:** John Henry PI #7415  
(Name and License Number of Inspector)

March 13, 2009  
(Date)

---

This property inspection report may include an inspection agreement (contract), addenda, and other information related to property conditions. If any item or comment is unclear, you should ask the inspector to clarify the findings. It is important that you carefully read ALL of this information.

This inspection is subject to the rules ("Rules") of the Texas Real Estate Commission ("TREC"), which can be found at [www.trec.state.tx.us](http://www.trec.state.tx.us).

The TREC Standards of Practice (Sections 535.227-535.231 of the Rules) are the minimum standards for inspections by TREC-licensed inspectors. An inspection addresses only those components and conditions that are present, visible, and accessible at the time of the inspection. While there may be other parts, components or systems present, only those items specifically noted as being inspected were inspected. The inspector is not required to move furnishings or stored items. The inspection report may address issues that are code-based or may refer to a particular code; however, this is NOT a code compliance inspection and does NOT verify compliance with manufacturer's installation instructions. The inspection does NOT imply insurability or warrantability of the structure or its components. Although some safety issues may be addressed in this report, this inspection is NOT a safety/code inspection, and the inspector is NOT required to identify all potential hazards.

In this report, the inspector will note which systems and components were Inspected (I), Not Inspected (NI), Not Present (NP), and/or Deficient (D). General deficiencies include inoperability, material distress, water penetration, damage, deterioration, missing parts, and unsuitable installation. Comments may be provided by the inspector whether or not an item is deemed deficient. The inspector is not required to prioritize or emphasize the importance of one deficiency over another.

Some items reported as Deficient may be considered life-safety upgrades to the property. For more information, refer to [Texas Real Estate Consumer Notice Concerning Recognized Hazards, form OP-I](#).

This property inspection is not an exhaustive inspection of the structure, systems, or components. The inspection may not reveal all deficiencies. A real estate inspection helps to reduce some of the risk involved in purchasing a home, but it cannot eliminate these risks, nor can the inspection anticipate future events or changes in performance due to changes in use or occupancy. It is recommended that you obtain as much information as is available about this property, including any seller's disclosures, previous inspection reports, engineering reports, building/remodeling permits, and reports performed for or by relocation companies, municipal inspection departments, lenders, insurers, and appraisers. You should also attempt to determine whether repairs, renovation, remodeling, additions, or other such activities have taken place at this property. It is not the inspector's responsibility to confirm that information obtained from these sources is complete or accurate or that this inspection is consistent with the opinions expressed in previous or future reports.

Items identified in the report do not obligate any party to make repairs or take other action, nor is the purchaser required to request that the seller take any action. When a deficiency is reported, it is the client's responsibility to obtain further evaluations and/or cost estimates from qualified service professionals. Any such follow-up should take place prior to the expiration of any time limitations such as option periods. Evaluations by qualified tradesmen may lead to the discovery of additional deficiencies

---

which may involve additional repair costs. Failure to address deficiencies or comments noted in this report may lead to further damage of the structure or systems and add to the original repair costs. The inspector is not required to provide follow-up services to verify that proper repairs have been made.

Property conditions change with time and use. For example, mechanical devices can fail at any time, plumbing gaskets and seals may crack if the appliance or plumbing fixture is not used often, roof leaks can occur at any time regardless of the apparent condition of the roof, and the performance of the structure and the systems may change due to changes in use or occupancy, effects of weather, etc. These changes or repairs made to the structure after the inspection may render information contained herein obsolete or invalid. This report is provided for the specific benefit of the client named above and is based on observations at the time of the inspection. If you did not hire the inspector yourself, reliance on this report may provide incomplete or outdated information. Repairs, professional opinions or additional inspection reports may affect the meaning of the information in this report. It is recommended that you hire a licensed inspector to perform an inspection to meet your specific needs and to provide you with current information concerning this property.

---

---

### ADDITIONAL INFORMATION PROVIDED BY INSPECTOR

---

---

**Highest priority items are printed in bold print and/or are in boxes**

**All commented items should be repaired or addressed to client's satisfaction PRIOR TO CLOSING.**

Items that are underlined should be addressed to prevent more extensive damage and should be a priority item or indicate non-compliance with current building standards

*Comments in italics are generally FYI (for your information) and don't require any action.*

---

---

**For Reference:** The front of unit faces west.

**Description:** 2 story, wood framed, Townhouse; Brick / Hardi-plank / wood exterior;  
Composition roof; Attached garage.

### I. STRUCTURAL SYSTEMS

#### A. Foundations

Type of Foundation(s):

*Type of house foundation is slab on grade.*

Comments:

*Performing intended function. No evidence suggesting significant foundation movement at time of inspection.*

Wood form board(s) around foundation should be removed to reduce chance of wood destroying insect activity.



#### B. Grading & Drainage

Comments:

*Buyer's note; ensure flower bed soil does not rise above foundation or brick weep holes to prevent water and wood destroying insect entry into house.*

#### C. Roof Covering Materials

Type(s) of Roof Covering:

*Type of roof material observed to be composition over solid decking.*

Viewed From:

*Roof observed from ground with binoculars due to height at eave and / or pitch of roof. Portions had limited visibility.*

Comments:

ROOF SURFACE: Good

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

VISIBLE FLASHING: Good

ROOF PENETRATIONS: Good

EVIDENCE OF ROOF WATER PENETRATION:  
*None observed at time of inspection.*

RAIN GUTTERS & DOWNSPOUTS: Good

**D. Roof Structure & Attic**


Viewed From: *Inside accessible areas of attic*

Approximate Average Depth of Insulation: *Not observed.*

Approximate Average Thickness of Vertical Insulation: *Not observed.*

Comments:

Buyer's Note: *Inspector was not able to access attic due to large bed below attic stairway.*

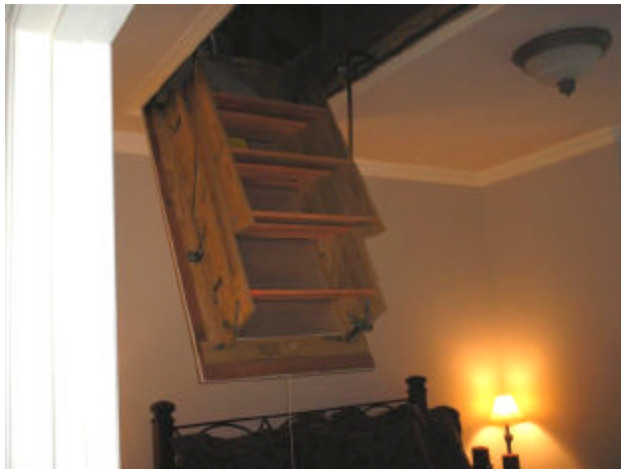

ROOF STRUCTURE AND FRAMING: Not checked / inspected

ATTIC INSULATION: Not checked / inspected

ATTIC ACCESS, LADDERS AND SERVICE WALKS: Good

ATTIC VENTILATION & SCREENING: Not checked / inspected

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**E. Walls (Interior & Exterior)**

Comments:

INTERIOR: Good

*Client Advisory: No moisture, mold and /or indoor air quality (IAQ) tests were performed. The inspector is not qualified / certified for such evaluations / studies. The client should be aware that various fungi, molds and mildew flourish in such an environment provided by water intrusion events, excessively moist conditions and / or water damaged conditions. A growing concern to date includes the adverse effect on indoor air quality and the potential for inherent health hazards. If concerned the client is advised to contact a qualified IAQ Professional for further evaluations of this property.*

EXTERIOR:

Earth wood contact in some areas, conducive condition to termite activity and wood rot.  
Wooden deck and wooden fence

Recommend caulking around electrical disconnect box(s) of A/C unit(s) to prevent water entry behind disconnect(s).

Need sealing / caulking around all holes and exterior siding penetrations on top and both sides, (leave bottom open) to prevent water entry. Including but not limited to dryer, bath and range top vents, light fixtures, etc.



EVIDENCE OF WATER PENETRATION:  
*None observed at time of inspection.*

**F. Ceilings & Floors**

Comments:

CEILINGS: Good

FLOORS: Good

**G. Doors (Interior & Exterior)**

Comments:

INTERIOR: Good

EXTERIOR:

*Prudent buyers replace/rekey exterior locks upon taking possession of property.*

Recommend caulking better interior ends of exterior door threshold water channel to prevent water entry during driving rains.



Exterior door jamb holes for dead bolt locks need adjustment for proper operation.

GARAGE: Good

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**H. Windows**

Comments:

*Not all windows were operated / accessible in furnished residence.*

**WINDOWS:**

Window jamb alarm sensors in breakfast room needs to be sealed better with silicone seal to prevent water entry.



SAFETY GLASS IN HAZARDOUS LOCATIONS: Good

**I. Stairways (Interior & Exterior)**

Comments:

INTERIOR: Good

EXTERIOR: Not present at time of inspection.

**J. Fireplace/Chimney**

Comments: *Did not test with remote*



**K. Porches, Balconies, Decks, and Carports**

Comments:

*Wooden deck obscures view of foundation and prevents visual inspection for termite and/or water penetration.*



*Cracks in garage concrete observed, typical.*

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**II. ELECTRICAL SYSTEMS**

**A. Service Entrance & Panels**

Comments:

**200 AMP ELECTRICAL SERVICE PANEL EXTERIOR SOUTH WALL:**

*Did not observe installed AFCI (Arc Fault Circuit Interrupt) device protection, as required by current building standards, for all: family rooms, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreations rooms, closets, hallways, or similar rooms or areas. AFCI devices are intended to protect against fires caused by electrical arcing faults in the home's wiring. Arc faults are a common cause of residential electrical fires. Arc faults can be created by damaged, deteriorated, or worn electrical plugs, cords, and/or branch circuit conductors. As of September 1, 2008, the State of Texas has adopted the 2005 NEC, which includes this requirement, as the "minimum standard" for all non-exempt electrical work. Homes built prior to 2002, generally were not required to have arc fault protection. However, the current TREC standard of practice requires inspectors to indicate that a hazardous or deficient condition exists if any home does not have this protection, regardless of date the home was constructed.*

**SERVICE WIRING:**

*Observed type of service wiring is underground.*

**FEEDER WIRING:**

*Observed type of feeder wiring is aluminum.*

*Did not observe anti-oxidant compound (grease) on the exposed aluminum feeder wiring.*

**B. Branch Circuits, Connected Devices and Fixtures**

Type of Wiring:

*Observed type of branch wiring is copper.*

Comments:

**BRANCH WIRING:**

**FIXTURES:**

Light(s) found to be not functioning. Probably just a burned out bulb, or it could be a broken fixture / switch or improper wiring. Including but not limited to; exterior front entryway and light over stairway.

**OUTLETS:**

*Not all outlets were checked / inspected / accessible in furnished residence.*

*Outlets located in inaccessible areas (e.g., garage ceilings, exterior soffits, etc.) are not individually tested.*


I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**OUTLETS:**

Did not observe GFCI protection of all outlets in required locations, including but not limited to; all bathrooms, all kitchen counter top outlets, wet bar locations, all exterior outlets, in garage, etc. This condition is a recognized safety hazard and is in need of repair.

One or more outlets in the following locations were not protected:

- Kitchen counter
- Kitchen island
- Bathrooms
- Garage  Exterior
- Wet bar  Laundry sink
- Pool area  Spa / hot tub
- Other:

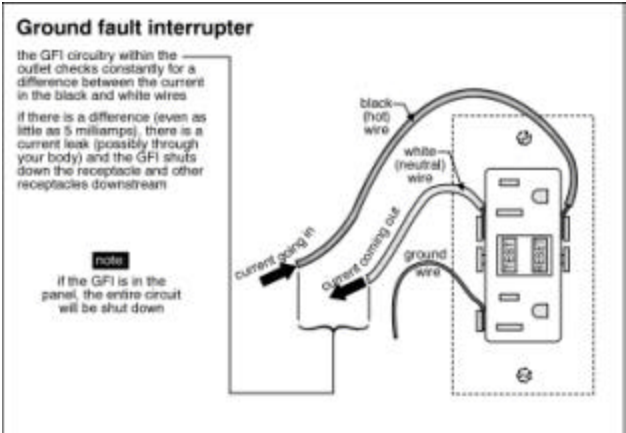

*GFCI reset locations; garage, kitchen, 1<sup>st</sup> floor half bath, 2<sup>nd</sup> floor guest bath, master bath and master bath commode room for spa tub motor.*

*Observed 4-prong outlet for dryer as required by current code. Will not fit older dryer with 3 prong electrical plug.*

**SWITCHES:**

*Unknown control, mystery switch(s) found, probably / possibly for fan kit in 2<sup>nd</sup> floor northeast bedroom.*

**EQUIPMENT DISCONNECTS:** Good

**SMOKE DETECTORS AND ALARMS:**

*Not checked / inspected*

*The installation of smoke alarm(s) is required inside of all bedrooms and in any rooms designated for the purpose of sleeping, and outside within the proximity of the doors to those rooms. Test all alarms and detectors weekly or monthly per manufacture instructions. The installation of carbon monoxide (CO) detector(s) is required in homes with fuel-fired appliances at every floor elevation and any areas where fuel-fired equipment is located. The installation of Type ABC fire extinguisher(s) at the kitchen, laundry, and garage, if applicable, is also advised. Test all of these devices monthly. Install new batteries semi-annually. Initiate and practice plans of escape and protection for all occupants in case any emergencies arise. Failure to repair defective or install absent alarms, detectors, and other safety equipment immediately can result in serious injury or death. For further information about fire safety and CO poisoning, consult your local fire department and your equipment manufacture(s), and read these links: [www.cpsc.gov/CPSCPUB/PUBS/464.pdf](http://www.cpsc.gov/CPSCPUB/PUBS/464.pdf), [www.carbonmonoxidekills.com](http://www.carbonmonoxidekills.com), [www.nfpa.org/index.asp](http://www.nfpa.org/index.asp), and [www.usfa.dhs.gov/downloads/pyfff/inhome.html](http://www.usfa.dhs.gov/downloads/pyfff/inhome.html).*

*Not all smoke detectors were accessible for testing:*

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

### III HEATING, VENTILATION, AND AIR-CONDITIONING SYSTEMS

#### A. Heating Equipment

Type of System: *Forced air*

Energy Source: *gas*

Comments:

1<sup>ST</sup> FLOOR HEATING UNIT:

Make: Unable to access attic to read data plate ()

Model #:

S/N:

2<sup>ND</sup> FLOOR HEATING UNIT:

Make: Unable to access attic to read data plate ()

Model #:

S/N:

HOUSE HEATER EXHAUST VENT(S): Not checked / inspected

BLOWER(S): Good

THERMOSTAT(S): Good

#### B. Cooling Equipment

Type of System: Forced air, split system

Comments:


*Air conditioning units were not operated due to cold outside temperatures at time of inspection. Running A/C unit when outside ambient temperature is below 65 degrees can damage the compressor and will not give proper readings. Common industry practice is to have HVAC systems serviced annually, don't wait till it breaks.*

Electrical line supplying power to A/C unit outside is not fully enclosed in protective conduit below A/C disconnect box.



I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

*Buyers note; Keep walls/fences/decks a minimum of 2 feet away from sides of A/C unit and a minimum of 4 feet over unit to allow proper air flow across coils and/or proper access to unit for servicing*

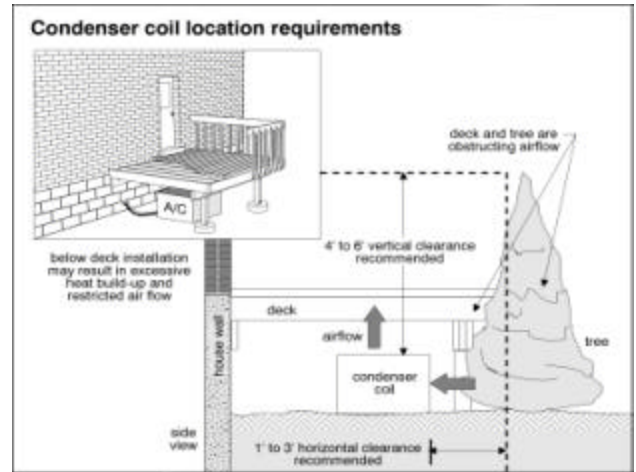

**1<sup>ST</sup> FLOOR CONDENSING UNIT:**

Make: Lennox (2004)  
 Model #: 13ACC-024-230-01 (2 tons)  
 S/N: 5804g06232

**1<sup>ST</sup> FLOOR EVAPORATOR COIL:**

Temperature Differential: = 0.0 degrees Not checked.

0. 0.  
 0 0

Make: Unable to access attic to read data plate ()  
 Capacity: tons

**2<sup>ND</sup> FLOOR CONDENSING UNIT:**

Make: Lennox (2004)  
 Model #: 13ACC-036-230-01 (3 tons)  
 S/N: 5804D30951

**2<sup>ND</sup> FLOOR EVAPORATOR COIL:**

Temperature Differential: = 0.0 degrees Not checked.

0. 0.  
 0 0

Make: Unable to access attic to read data plate ()  
 Capacity: tons

**CONDENSATION DRAIN PAN / DRAIN LINES:** Not checked / inspected

**C. Duct System, Chases, and Vents**

Comments: Unable to access attic

I = Inspected    NI = Not Inspected    NP = Not Present    D = Deficiency

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

RETURN DUCTS CHASES AND VENTS: Not checked / inspected

SUPPLY DUCTS CHASES AND VENTS: Not checked / inspected

**IV. PLUMBING SYSTEM**

**A. Water Supply System and Fixtures**

Location of water meter: *West of property*

Location of main water supply valve: *Main shut off valve is located in the garage south wall*

Static water pressure reading: *55 psi*

Comments:

**WATER SUPPLY PLUMBING:**

*Water supply piping observed to be predominantly plastic.*

*Water softener, treatment and filtration type equipment is not checked / inspected.*

COMMODOES: Good

SINKS: Good

FAUCETS:

*Handle is loose / not secure; master bath south sink cold water.*



TUB(S):

*Porcelain damaged/chipped on steel tub; 2<sup>nd</sup> floor guest bath.*

SHOWER(S): Good

*24 hour shower pan test specifically excluded.*

LAUNDRY CONNECTIONS:

*4-Prong outlet for dryer as required by current code. Will not fit older dryer with 3-prong electrical plug.*

*Recommend use of stainless steel wire braided "no burst" clothes washer water supply lines to reduce chance of water damage.*



EXTERIOR HOSE BIBS: Good

**B. Drains, Wastes and Vents**

Comments:

*Hydrostatic pressure test of sewer lines specifically excluded.*

**DRAIN, WASTE, VENT PLUMBING:**

*Observed to be predominantly plastic.*

The sheetrock has not been removed behind the 2<sup>nd</sup> floor guest bath plumbing access / inspection panels behind the tub(s). Recommend removal of sheetrock.



I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**C. Water Heating Equipment**

Energy Source: *Not checked / inspected*

Capacity: *Not checked / inspected*

Comments: *Unable to access the attic*

**WATER HEATING UNIT(S):**

Water temperature is too hot, scalding hazard, temperature measured above 140 degrees.

The following temperatures will produce 2<sup>nd</sup> & 3<sup>rd</sup> degree burns on adult skin:

160°F in about 1/2 second

150°F in about 1-1/2 seconds

140°F in less than 5 seconds

130°F in about 30 seconds

120°F takes more than 5 minutes.



WATER HEATER EXHAUST VENT(S): Not checked / inspected

TEMPERATURE & PRESSURE RELIEF VALVE(S): Not checked / inspected

**D. Hydro-Massage Therapy Equipment**

Comments:

Missing screw on spa tub motor access panel.

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**V. APPLIANCES**

**A. Dishwasher**

Comments: Good

**B. Food Waste Disposer**

Comments: Good

**C. Range Exhaust Vent**

Comments: Good

**D. Ranges, Cooktops, and Ovens**

Comments:

GAS RANGE/COOKTOP: Good

ELECTRIC OVEN: Good

*Timer and cleaning cycles not checked*

**E. Microwave Oven**

Comments: Good

**F. Trash Compactor**

Comments: *Not present at time of inspection.*

**G. Mechanical Exhaust Vents and Bathroom Heaters**

Comments: Good

**H. Garage Door Operator(s)**

Comments:

Unit has excessive vibration / noise level; recommend lubrication.

*Remote control hand held units were not checked.*

**I. Doorbell and Chimes**

Comments: Good

I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**J. Dryer Vents**

Comments:

*Recommend periodic cleaning dryer venting duct of lint to reduce risk of fire.*

*Buyer's Note: Observed a dryer type vent installed in south wall of garage for unknown reason.*



I	NI	NP	D	Inspection Item
---	----	----	---	-----------------

**VI. OPTIONAL SYSTEMS**

**A. Lawn and Garden Sprinkler Systems**  
 Comments: Not present at time of inspection.

**B. Outbuildings**  
 Comments: *Not present at time of inspection.*

**C. Outdoor Cooking Equipment**  
 Energy Source: *gas*  
 Comments:  
Igniter does not operate properly.

**D. Gas Supply Systems**  
 Comments:  
*Main shutoff located at south side of house.*  
*Pressure test of gas lines specifically excluded.*  
  
 OBSERVED BRANCH LINES:  
*Galvanized and/or black iron.*  
  
 APPLIANCE CONNECTIONS:  
*Proper flex.*

**E. Whole-House Vacuum Systems**  
 Comments: *Not present at time of inspection.*

**F. Other Built-in Appliances**  
 Comments: Not checked / inspected

**G. Security Systems**  
 Comments: *Not checked/inspected.*

***INTENT OF INSPECTION:***

It is the expressed intent and purpose of this report to inform you the client exclusively of the **visual ("eyeball") observations** and opinions made on the day of the inspection as to whether or not the structure, electrical, plumbing, and mechanical components of the subject property are performing the function for which they were intended to perform or are in need of immediate repairs. It is not within the intent and/or scope of this report to determine the insurability, habitability, suitability of use, economic life span, deferred maintenance issues, and/or issues unnamed in this report.

**This report is neither an expressed nor implied warranty and / or guarantee as to future life and/or performance of the items inspected**, but is intended to express the inspector's perceived impression of the apparent performance of the structure, electrical, plumbing, and mechanical components viewed on the date of the inspection. **Our intent is to reduce your risk associated with this transaction, however we cannot eliminate all risk nor assume your risk.**

***SCOPE OF INSPECTION:***

The content of this report is based solely upon "eyeball" observations of apparent performance. Opinions have been formed from the inspector's personal knowledge and experience and not upon any code requirements and/or performance standards. Compliance with any federal, state or local codes and/or other legal requirements is not within the scope or intent of this report.

***METHOD OF INSPECTION:***

The inspection methodology has not been of a formal engineered type of inspection; therefore, no soil, physical or geological testing or inspections were performed. Many of the structural, electrical, plumbing, and mechanical components were judged indirectly by the visible condition of the surfaces and/or components open to view. Observations were made both inside as well as outside of the structure; however, these observations were limited to only those areas open to view without moving any item, i.e.; inhabitants furniture, belongings or stored items which was blocking the view.

The inspector did not employ any instruments to aid in the inspection, **disassemble any component of an item checked**, (i.e.: disassemble a heating unit to inspect for a cracked heat exchanger), conduct extensive destructive testing, calculations, or removal of wall and floor covering unless noted in the body of this report.

***LIMITATION OF INSPECTION:***

The visual inspection method employed will generally produce a competent first impression assessment of the apparent past structural, electrical, plumbing, and mechanical components, provided refurbishing repairs have not been performed which would mask distress patterns normally produce by structural, electrical, plumbing, and mechanical components problems.

**Because the inspection procedure is visual only and was not intended to be diagnostic and/or technically exhaustive, an inherent residual risk remains that undiscovered problems exist and/or future problems will develop.**

There is no guarantee or warranty stated or implied that all defects have been found or that FIG Services, LLC d/b/a Fox Inspection Group will pay for the repair of any defect not discovered. The content of this report should be considered as an opinion of apparent performance of the items inspected and not engineering fact.

**THIS INSPECTION DOES NOT INCLUDE THE INSPECTION OF, SAMPLING FOR OR TESTING OF ANY SUBSTANCE CLASSIFIED OR OTHERWISE IDENTIFIED WITH OR AS A TOXIC SUBSTANCE AND/OR BIO-HAZARD OR WOOD DESTROYING INSECTS/ORGANISMS.**

*Client Advisory: No moisture, mold and /or indoor air quality (IAQ) tests were performed, The inspector is not qualified / certified for such evaluations / studies. The client should be aware that various fungi, molds and mildew flourish in such an environment provided by water intrusion events, excessively moist conditions and / or water damaged conditions. A growing concern to date includes the adverse effect on indoor air quality and the potential for inherent health hazards. If concerned the client is advised to contact a qualified IAQ Professional for further evaluations of this property.*

**EXPERT TESTIMONY / LITIGATION FINANCIAL COMPENSATION CLAUSE:**

In the event our services are needed at any time in the future as expert testimony or in a litigation case, client agrees at this time / in advance to financially compensate this firm for it's time and services.

Terms: Non-refundable retainer of \$2,500.00 upfront, Hourly rate of \$175.00 for any activities on our part for your case, including but not limited to; deposition, phone time, research, court time, travel time portal to portal, review of case prior to court appearance, etc. Balance due invoiced weekly, submitted Wednesday, payable the next Friday

**ARBITRATION / DISPUTE RESOLUTION**

In the event a dispute arises regarding an inspection that has been performed under this service agreement, Client(s) agree to notify FIG Services, LLC d/b/a Fox Inspection Group within ten (10) days of the time of discovery to give Fox Inspection Group a reasonable opportunity to re-inspect the property and resolved the dispute amicably. Upon the request of either party, all unresolved disputes relating to this agreement shall be submitted for arbitration in accordance with (AAA) American Association of Arbitrators then in effect with costs shared equally. This provision shall be specifically enforceable and damages for breach of this provision shall include but not limited to court costs and attorney's fees. Client agrees that FIG Services, LLC d/b/a Fox Inspection Group and it's agents liability, if any, shall be limited to the amount of the inspection fee paid for inspection. This limitation shall apply regardless of the cause of action or the legal theory pled or asserted specifically including, but not limited to, negligence.

FIG Services, LLC d/b/a Fox Inspection Group does not conduct re-inspection services for any reason. We are not in the business of certifying workmanship and/or warranting another company's repair work. Receipts and/or warranty for work performed should be obtained from the company or companies who have provided repairs.

Acceptance and/or reliance on this report shall constitute an acknowledgment, acceptance, and agreement by Client(s) as well as any spouse / significant other, and/or any assigns to all terms, conditions, exclusions and limitations of this report as well as an acknowledgment that the inspection includes only those items listed as inspected in the inspection report.